

14800
Ameren Services

Environmental, Safety & Health
314.554.4908 (Phone)
314.554.4182 (Facsimile)
scwhitworth@ameren.com

January 28, 2005

ID. # 143805AAG

Title: Tiller
Project: Tiller Category: LO

One Ameren Plaza
1901 Chouteau Avenue
PO Box 66149
St. Louis, MO 63166-6149
314.621.3222
nfa

Ms. Julie K. Armitage, Manager
Compliance and Enforcement Section
Bureau of Air
Illinois Environmental Protection Agency
1021 North Grand Avenue East
P. O. Box 19726
Springfield, IL 62794-9276

RECEIVED
JAN 31 2005
Illinois Environmental Protection Agency

8812-08


**RE: Opacity Monitoring Performance and Emission Reports
Edwards Units 1, 2 and 3; Facility I. D. 143805AAG**

Dear Ms. Armitage:

In accordance with 40 CFR Part 75 - Continuous Emission Monitoring Subpart G
Section 75.65 and 35 Ill. Adm. Code Part 201 Subpart L - Continuous Monitoring;
Ameren Services as authorized agent for AmerenEnergy Resources Generating
Company submits the Excess Emission and Monitoring System Performance Reports
for opacity for Edwards unit 1, 2 and 3 for the Fourth Quarter 2004.

Please contact me if you have any questions concerning this submittal.

Sincerely,

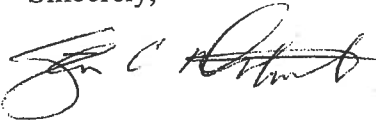

Steven C. Whitworth
Supervising Environmental Scientist

Attachments

cc: Mr. Dean F. Hayden, P. E.
Division of Air Pollution Control - Regional Office
Illinois Environmental Protection Agency
5415 North University Mall Street
Peoria, IL 61614

Facility Name: ARG - Edwards Power Plant
Excess Emissions Report
Reporting Period: 10/01/2004 to 12/31/2004
Time of Report: 01/17/05 14:28

Page: 1

Site: UNIT 1 & 2
Parameter: STAKOPAC
Average Interval: 6 min

Standard Limit: 30.490 PERCENT
Exceptional Limit: N/A
Low Limit: N/A

Date	Time	Magnitude	Reason Code	Reason Message	Action Message
10/03/04	02:30	30.671	64	Control Equipment Problems	(54) Reduced Load; Repaired Flue Gas Conditioning Malfunction
10/03/04	02:42	31.050	64	Control Equipment Problems	(54) Reduced Load; Repaired Flue Gas Conditioning Malfunction
10/03/04	09:00	30.997	64	Control Equipment Problems	(13) Adj Comb Contl;Dropped Load
10/04/04	15:06	40.852	66	Other Known Causes	(57) Stopped Blowing Soot
10/05/04	06:36	32.385	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load
10/05/04	10:06	33.729	66	Other Known Causes	(57) Stopped Blowing Soot
10/05/04	13:30	33.586	65	Process Problems	(19) Adj Burner Controls;Problem Resolved
10/06/04	17:06	37.753	65	Process Problems	(60) Dropped Load and Increased Air Flow
10/07/04	20:00	34.621	66	Other Known Causes	(57) Stopped Blowing Soot
10/08/04	11:12	34.244	66	Other Known Causes	(57) Stopped Blowing Soot
10/08/04	21:30	34.055	66	Other Known Causes	(57) Stopped Blowing Soot
10/09/04	01:00	30.753	66	Other Known Causes	(62) Stop Power Rapping
10/10/04	01:06	33.279	66	Other Known Causes	(62) Stop Power Rapping
10/11/04	18:30	32.063	66	Other Known Causes	(57) Stopped Blowing Soot
10/14/04	15:54	34.791	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load
10/14/04	17:54	31.219	66	Other Known Causes	(57) Stopped Blowing Soot
10/15/04	05:12	31.680	66	Other Known Causes	(57) Stopped Blowing Soot
10/15/04	13:12	34.381	65	Process Problems	(13) Adj Comb Contl;Dropped Load
10/15/04	17:06	30.753	66	Other Known Causes	(57) Stopped Blowing Soot
10/16/04	05:12	33.182	65	Process Problems	(13) Adj Comb Contl;Dropped Load
10/16/04	05:18	31.075	65	Process Problems	(13) Adj Comb Contl;Dropped Load
10/16/04	19:36	40.695	66	Other Known Causes	(57) Stopped Blowing Soot
10/18/04	02:18	33.239	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup
10/18/04	10:00	34.518	66	Other Known Causes	(57) Stopped Blowing Soot
10/18/04	18:06	32.138	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load
10/18/04	18:54	33.146	67	Unknown Causes	(13) Adj Comb Contl;Dropped Load
10/19/04	18:12	37.980	64	Control Equipment Problems	(13) Adj Comb Contl;Dropped Load
10/19/04	18:18	67.869	64	Control Equipment Problems	(13) Adj Comb Contl;Dropped Load
10/19/04	18:24	37.947	64	Control Equipment Problems	(13) Adj Comb Contl;Dropped Load
10/21/04	22:48	31.691	65	Process Problems	(14) Adj Comb Contl;Stabilized Boiler
10/22/04	00:48	32.075	65	Process Problems	(60) Dropped Load and Increased Air Flow
10/22/04	12:18	32.966	65	Process Problems	(60) Dropped Load and Increased Air Flow
10/23/04	12:30	30.594	66	Other Known Causes	(57) Stopped Blowing Soot
10/26/04	13:30	32.263	65	Process Problems	(13) Adj Comb Contl;Dropped Load
10/27/04	01:30	49.786	65	Process Problems	(13) Adj Comb Contl;Dropped Load
10/30/04	15:36	31.364	66	Other Known Causes	(57) Stopped Blowing Soot
11/01/04	05:54	34.174	65	Process Problems	(13) Adj Comb Contl;Dropped Load
11/01/04	11:12	70.036	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load
11/04/04	11:06	30.974	65	Process Problems	(13) Adj Comb Contl;Dropped Load
11/07/04	13:36	33.083	66	Other Known Causes	(57) Stopped Blowing Soot
11/11/04	08:36	35.676	66	Other Known Causes	(57) Stopped Blowing Soot
11/15/04	09:48	31.257	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load
11/15/04	17:18	33.447	67	Unknown Causes	(13) Adj Comb Contl;Dropped Load

Facility Name: ARG - Edwards Power Plant
Excess Emissions Report
Reporting Period: 10/01/2004 to 12/31/2004
Time of Report: 01/17/05 14:28

Page: 2

Site: UNIT 1 & 2
Parameter: STAKOPAC
Average Interval: 6 min

Standard Limit: 30.490 PERCENT
Exceptional Limit: N/A
Low Limit: N/A

Date	Time	6 min Empty	6 min Index	Magnitude 2 hrs Unknown	Reason Code	Reason Message
11/16/04	09:54		1	31.628	67	Unknown Causes (08) Adj Comb Contl;Reduced Load Pickup
11/19/04	10:36	0	1	32.809	67	Unknown Causes (13) Adj Comb Contl;Dropped Load
11/19/04	10:42			31.646	67	Unknown Causes (13) Adj Comb Contl;Dropped Load
11/25/04	08:18		1	31.297	66	Other Known Causes (08) Adj Comb Contl;Reduced Load Pickup
11/28/04	18:00		3	51.766	65	Process Problems (06) Adj Comb Contl;Unplugged Feeder
11/29/04	10:00		3	31.222	65	Process Problems (06) Adj Comb Contl;Unplugged Feeder
11/29/04	12:42			52.481	65	Process Problems (06) Adj Comb Contl;Unplugged Feeder
11/29/04	20:30			40.631	65	Process Problems (14) Adj Comb Contl;Stabilized Boiler
12/01/04	23:12		1	33.705	67	Unknown Causes (02) Low Precip Power;Adjusted Precip Power
12/02/04	20:12		1	32.774	66	Other Known Causes (57) Stopped Blowing Soot
12/05/04	13:48		2	32.004	65	Process Problems (13) Adj Comb Contl;Dropped Load
12/06/04	06:18			30.662	64	Control Equipment Problems (08) Adj Comb Contl;Reduced Load Pickup
12/09/04	17:48		1	40.717	67	Unknown Causes (13) Adj Comb Contl;Dropped Load
12/14/04	11:36		1	30.838	66	Other Known Causes (13) Adj Comb Contl;Dropped Load
12/18/04	01:36			32.042	64	Control Equipment Problems (02) Low Precip Power;Adjusted Precip Power
12/18/04	02:24		2	32.639	64	Control Equipment Problems (01) Low Precip Power;Reset Precip
12/18/04	02:30	10	2	35.576	64	Control Equipment Problems (01) Low Precip Power;Reset Precip
12/18/04	02:36			30.594	64	Control Equipment Problems (01) Low Precip Power;Reset Precip
12/18/04	02:48			30.784	64	Control Equipment Problems (01) Low Precip Power;Reset Precip
12/21/04	10:36		2	31.306	66	Other Known Causes (48) Adjust Sulfur Ratio
12/21/04	13:54		1	31.601	64	Control Equipment Problems (01) Low Precip Power;Reset Precip
12/24/04	16:42			33.339	66	Other Known Causes (57) Stopped Blowing Soot

Facility Name: ARG - Edwards Power Plant
 Excess Emissions Report
 Reporting Period: 10/01/2004 to 12/31/2004
 Time of Report: 01/17/05 15:09

Site: UNIT 3 COMBINED (COMS IN DUCT 3A AND DUCT 3B) Standard Limit: 30.490 PERCENT
 Parameter: STAKOPAC Exceptional Limit: N/A
 Average Interval: 6 min Low Limit: N/A

Date	Time	Magnitude	Reason Code	Reason Message	Action Code	Action Message
10/01/04	08:24	31.697	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
10/09/04	14:18	33.139	64	Control Equipment Problems	(08) Adj Comb Contl;Reduced Load Pickup	
10/09/04	15:18	34.703	66	Other Known Causes	(57) Stopped Blowing Soot	
10/10/04	05:30	37.115	66	Other Known Causes	(57) Stopped Blowing Soot	
10/10/04	14:12	30.585	65	Process Problems	(59) Increased Air Flow	
10/10/04	16:18	30.790	65	Process Problems	(47) Reduced Furnace Air Flow	
10/11/04	03:18	34.537	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
10/14/04	07:42	35.103	65	Process Problems	(13) Adj Comb Contl;Dropped Load	
10/15/04	06:30	30.739	65	Process Problems	(14) Adj Comb Contl;Stabilized Boiler	
10/15/04	14:18	31.643	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
10/15/04	20:24	34.978	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
10/16/04	15:42	30.599	66	Other Known Causes	(57) Stopped Blowing Soot	
10/17/04	16:24	37.183	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
10/17/04	20:30	39.068	67	Unknown Causes	(13) Adj Comb Contl;Dropped Load	
10/18/04	14:24	36.626	66	Other Known Causes	(57) Stopped Blowing Soot	
10/19/04	16:54	37.321	64	Control Equipment Problems	(08) Adj Comb Contl;Reduced Load Pickup	
10/20/04	05:18	31.590	67	Unknown Causes	(13) Adj Comb Contl;Dropped Load	
10/20/04	08:30	35.993	64	Control Equipment Problems	(54) Reduced Load; Repaired Flue Gas Conditioning Malfunction	
10/20/04	16:00	31.948	66	Other Known Causes	(57) Stopped Blowing Soot	
10/21/04	00:30	30.789	66	Other Known Causes	(57) Stopped Blowing Soot	
10/21/04	06:06	35.125	64	Control Equipment Problems	(01) Low Prec p Power;Reset Precip	
10/22/04	12:18	30.844	66	Other Known Causes	(57) Stopped Blowing Soot	
10/23/04	09:30	31.312	66	Other Known Causes	(57) Stopped Blowing Soot	
10/23/04	20:00	31.275	66	Other Known Causes	(57) Stopped Blowing Soot	
10/24/04	02:54	36.224	64	Control Equipment Problems	(62) Stop Power Rapping	
10/25/04	14:12	31.254	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
10/25/04	17:42	47.593	66	Other Known Causes	(57) Stopped Blowing Soot	
10/26/04	21:18	44.390	66	Other Known Causes	(57) Stopped Blowing Soot	
10/27/04	08:00	32.344	67	Unknown Causes	(13) Adj Comb Contl;Dropped Load	
10/28/04	17:48	30.701	66	Other Known Causes	(57) Stopped Blowing Soot	
10/29/04	03:54	30.541	66	Other Known Causes	(57) Stopped Blowing Soot	
10/29/04	08:30	54.174	65	Process Problems	(06) Adj Comb Contl;Unplugged Feeder	
10/29/04	14:36	31.610	66	Other Known Causes	(57) Stopped Blowing Soot	
10/31/04	16:18	33.651	63	Start Up / Shutdown		
10/31/04	17:36	35.660	65	Process Problems	(11) Adj Comb Contl;Placed Mill In Service.	
11/02/04	09:48	32.063	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
11/03/04	10:18	31.787	66	Other Known Causes	(57) Stopped Blowing Soot	
11/03/04	13:36	30.816	66	Other Known Causes	(57) Stopped Blowing Soot	
11/04/04	01:06	54.493	65	Process Problems	(06) Adj Comb Contl;Unplugged Feeder	
11/04/04	01:12	31.108	65	Process Problems	(06) Adj Comb Contl;Unplugged Feeder	
11/04/04	10:48	38.024	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
11/04/04	12:00	30.591	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
11/05/04	12:42	30.707	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
11/05/04	14:18	31.961	66	Other Known Causes	(57) Stopped Blowing Soot	
11/05/04	19:00	31.021	66	Other Known Causes	(57) Stopped Blowing Soot	
11/06/04	21:30	30.545	66	Other Known Causes	(62) Stop Power Rapping	

Facility Name: ARG - Edwards Power Plant
 Excess Emissions Report
 Reporting Period: 10/01/2004 to 12/31/2004
 Time of Report: 01/17/05 15:09

Site: UNIT 3 COMBINED (COMS IN DUCT 3A AND DUCT 3B) Standard Limit: 30.490 PERCENT
 Parameter: STAKOPAC Exceptional Limit: N/A
 Average Interval: 6 min Low Limit: N/A

Date	Time	Magnitude	Reason Code	Reason Message	Action Code	Action Message
11/09/04	09:24	47.650	63	Start-Up / Shutdown	(61)	Shutdown Boiler
11/11/04	17:18	32.407	66	Other Known Causes	(13)	Adj Comb Contl;Dropped Load
11/12/04	08:42	30.697	64	Control Equipment Problems	(13)	Adj Comb Contl;Dropped Load
11/12/04	11:18	39.212	66	Other Known Causes	(62)	Stop Power Rapping
11/12/04	17:36	34.267	66	Other Known Causes	(13)	Adj Comb Contl;Dropped Load
11/15/04	09:48	30.638	66	Other Known Causes	(57)	Stopped Blowing Soot
11/15/04	10:42	30.919	64	Control Equipment Problems	(01)	Low Precip Power;Reset Precip
11/18/04	16:42	31.234	66	Other Known Causes	(57)	Stopped Blowing Soot
11/18/04	21:48	38.619	66	Other Known Causes	(57)	Stopped Blowing Soot
11/19/04	20:00	33.808	66	Other Known Causes	(57)	Stopped Blowing Soot
11/22/04	07:30	36.950	64	Control Equipment Problems	(01)	Low Precip Power;Reset Precip
11/22/04	17:00	31.298	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
11/22/04	20:54	31.995	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
11/23/04	02:18	31.576	66	Other Known Causes	(62)	Stop Power Rapping
11/25/04	01:48	31.678	64	Control Equipment Problems	(01)	Low Precip Power;Reset Precip
11/25/04	03:12	33.091	66	Other Known Causes	(62)	Stop Power Rapping
11/27/04	03:48	34.225	66	Other Known Causes	(08)	Adj Comb Contl;Reduced Load Pickup
11/28/04	01:18	32.671	66	Other Known Causes	(62)	Stop Power Rapping
11/30/04	23:30	30.758	65	Process Problems	(14)	Adj Comb Contl;Stabilized Boiler
12/01/04	09:18	31.131	64	Control Equipment Problems	(01)	Low Precip Power;Reset Precip
12/03/04	10:48	35.719	66	Other Known Causes	(57)	Stopped Blowing Soot
12/03/04	17:12	30.789	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
12/05/04	04:00	32.389	64	Control Equipment Problems	(01)	Low Precip Power;Reset Precip
12/07/04	14:00	33.145	64	Control Equipment Problems	(01)	Low Precip Power;Reset Precip
12/07/04	15:48	31.737	66	Other Known Causes	(57)	Stopped Blowing Soot
12/07/04	17:54	31.195	66	Other Known Causes	(57)	Stopped Blowing Soot
12/07/04	20:06	34.433	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
12/08/04	07:30	31.175	66	Other Known Causes	(57)	Stopped Blowing Soot
12/08/04	09:06	32.550	66	Other Known Causes	(57)	Stopped Blowing Soot
12/08/04	11:42	31.624	66	Other Known Causes	(57)	Stopped Blowing Soot
12/08/04	13:54	32.035	66	Other Known Causes	(57)	Stopped Blowing Soot
12/08/04	17:36	32.060	66	Other Known Causes	(57)	Stopped Blowing Soot
12/08/04	18:42	30.858	66	Other Known Causes	(57)	Stopped Blowing Soot
12/09/04	08:54	31.227	66	Other Known Causes	(57)	Stopped Blowing Soot
12/09/04	11:18	30.566	66	Other Known Causes	(57)	Stopped Blowing Soot
12/10/04	09:06	31.344	66	Other Known Causes	(57)	Stopped Blowing Soot
12/10/04	09:48	38.908	64	Control Equipment Problems	(07)	Adj Comb Contl;During Load pick-up
12/10/04	09:54	36.734	64	Control Equipment Problems	(07)	Adj Comb Contl;During Load pick-up
12/10/04	13:48	33.297	64	Control Equipment Problems	(13)	Adj Comb Contl;Dropped Load
12/10/04	15:00	30.736	64	Control Equipment Problems	(13)	Adj Comb Contl;Dropped Load
12/10/04	15:30	31.626	64	Control Equipment Problems	(13)	Adj Comb Contl;Dropped Load
12/10/04	17:00	36.409	64	Control Equipment Problems	(13)	Adj Comb Contl;Dropped Load
12/11/04	01:12	44.178	63	Start-Up / Shutdown	(61)	Shutdown Boiler
12/11/04	01:18	45.932	63	Start-Up / Shutdown	(61)	Shutdown Boiler
12/13/04	19:06	37.812	63	Start-Up / Shutdown	(01)	Low Precip Power;Reset Precip
12/13/04	20:12	32.993	63	Start-Up / Shutdown	(08)	Adj Comb Contl;Reduced Load Pickup
12/13/04	20:18	46.420	63	Start-Up / Shutdown	(08)	Adj Comb Contl;Reduced Load Pickup

Facility Name: ARG - Edwards Power Plant
 Excess Emissions Report
 Reporting Period: 10/01/2004 to 12/31/2004
 Time of Report: 01/17/05 15:09

Site: UNIT 3 COMBINED (COMS IN DUCT 3A AND DUCT 3B) Standard Limit: 30.490 PERCENT
 Parameter: STAKOPAC Exceptional Limit: N/A
 Average Interval: 6 min Low Limit: N/A

Date	Time	Magnitude	Reason Code	Reason Message	Action Code	Action Message
12/13/04	21:00	31.725	63	Start-Up / Shutdown	(08) Adj Comb Contl;Reduced Load Pickup	
12/14/04	03:24	40.063	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/14/04	04:24	37.026	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/14/04	04:36	36.256	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/14/04	09:30	33.420	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
12/14/04	11:12	35.703	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
12/14/04	11:18	36.198	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
12/14/04	11:24	35.384	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
12/14/04	11:30	35.735	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
12/14/04	11:36	32.247	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
12/14/04	11:42	31.314	66	Other Known Causes	(07) Adj Comb Contl;During Load pick-up	
12/14/04	13:00	32.500	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/14/04	13:06	36.461	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/14/04	13:24	32.589	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/14/04	14:00	34.219	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/15/04	07:24	32.694	67	Unknown Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/15/04	07:30	37.490	67	Unknown Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/15/04	07:36	32.120	67	Unknown Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/15/04	09:42	32.655	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/15/04	09:48	32.787	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/15/04	10:30	33.817	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/15/04	11:24	41.112	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/15/04	14:18	31.612	66	Other Known Causes	(57) Stopped Blowing Soot	
12/15/04	14:24	30.648	66	Other Known Causes	(57) Stopped Blowing Soot	
12/15/04	15:48	32.767	66	Other Known Causes	(57) Stopped Blowing Soot	
12/15/04	17:42	31.618	66	Other Known Causes	(57) Stopped Blowing Soot	
12/15/04	19:00	32.547	66	Other Known Causes	(57) Stopped Blowing Soot	
12/15/04	19:36	31.612	66	Other Known Causes	(57) Stopped Blowing Soot	
12/15/04	19:48	32.562	66	Other Known Causes	(57) Stopped Blowing Soot	
12/17/04	11:42	33.101	64	Control Equipment Problems	(01) Low Precip Power;Reset Precip	
12/19/04	14:06	30.629	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
12/19/04	18:06	31.258	65	Process Problems	(60) Dropped Load and Increased Air Flow	
12/20/04	12:54	34.640	66	Other Known Causes	(57) Stopped Blowing Soot	
12/20/04	19:42	34.088	66	Other Known Causes	(57) Stopped Blowing Soot	
12/21/04	01:00	31.500	66	Other Known Causes	(57) Stopped Blowing Soot	
12/21/04	03:54	30.727	66	Other Known Causes	(57) Stopped Blowing Soot	
12/21/04	04:06	34.799	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/21/04	08:54	34.427	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
12/21/04	16:30	31.568	66	Other Known Causes	(13) Adj Comb Contl;Dropped Load	
12/21/04	22:06	31.145	67	Unknown Causes	(13) Adj Comb Contl;Dropped Load	
12/22/04	06:00	32.889	66	Other Known Causes	(08) Adj Comb Contl;Reduced Load Pickup	
12/22/04	10:54	33.948	64	Control Equipment Problems	(01) Low Precip Power;Reset Precip	
12/23/04	02:24	30.778	66	Other Known Causes	(57) Stopped Blowing Soot	
12/23/04	15:18	30.655	64	Control Equipment Problems	(02) Low Precip Power;Adjusted Precip Power	
12/23/04	17:24	31.193	66	Other Known Causes	(57) Stopped Blowing Soot	
12/23/04	18:54	30.778	66	Other Known Causes	(57) Stopped Blowing Soot	
12/23/04	20:36	33.006	66	Other Known Causes	(57) Stopped Blowing Soot	

Facility Name: ARG - Edwards Power Plant
Excess Emissions Report
Reporting Period: 10/01/2004 to 12/31/2004
Time of Report: 01/17/05 15:09

Site: UNIT 3 COMBINED (COMS IN DUCT 3A AND DUCT 3B) Standard Limit: 30.490 PERCENT
Parameter: STAKOPAC Exceptional Limit: N/A
Average Interval: 6 min Low Limit: N/A

Date	Time	Magnitude	Reason Code	Reason Message	Action Code	Action Message
12/23/04	20:42	31.715	66	Other Known Causes	(57)	Stopped Blowing Soot
12/23/04	21:36	31.022	66	Other Known Causes	(57)	Stopped Blowing Soot
12/24/04	18:42	35.538	66	Other Known Causes	(14)	Adj Comb Contl;Stabilized Boiler
12/24/04	22:24	34.194	66	Other Known Causes	(14)	Adj Comb Contl;Stabilized Boiler
12/26/04	21:18	31.290	66	Other Known Causes	(57)	Stopped Blowing Soot
12/27/04	05:24	33.993	66	Other Known Causes	(57)	Stopped Blowing Soot
12/27/04	08:12	37.267	66	Other Known Causes	(57)	Stopped Blowing Soot
12/28/04	02:24	36.534	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
12/28/04	03:00	32.016	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
12/28/04	05:12	37.579	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power
12/29/04	16:00	33.746	64	Control Equipment Problems	(13)	Adj Comb Contl;Dropped Load
12/31/04	17:48	33.343	64	Control Equipment Problems	(02)	Low Precip Power;Adjusted Precip Power

